



# CONGORILLA

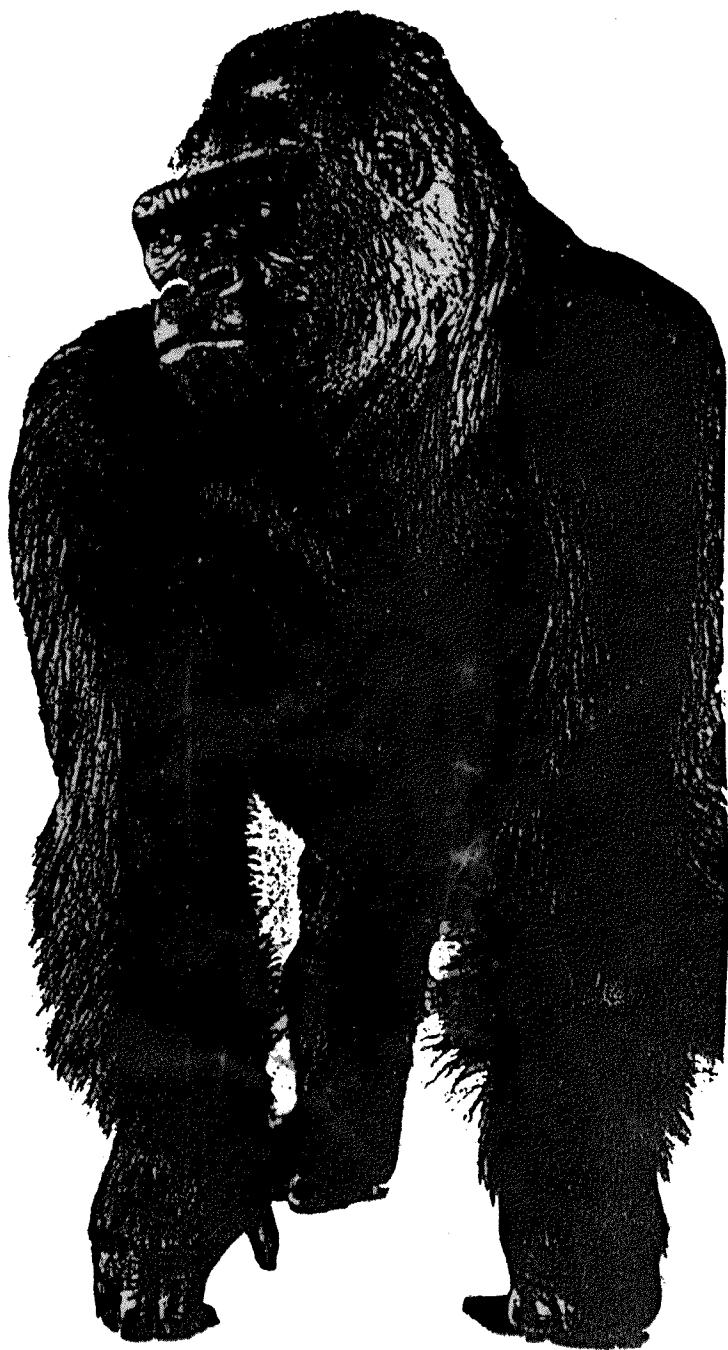

Manual

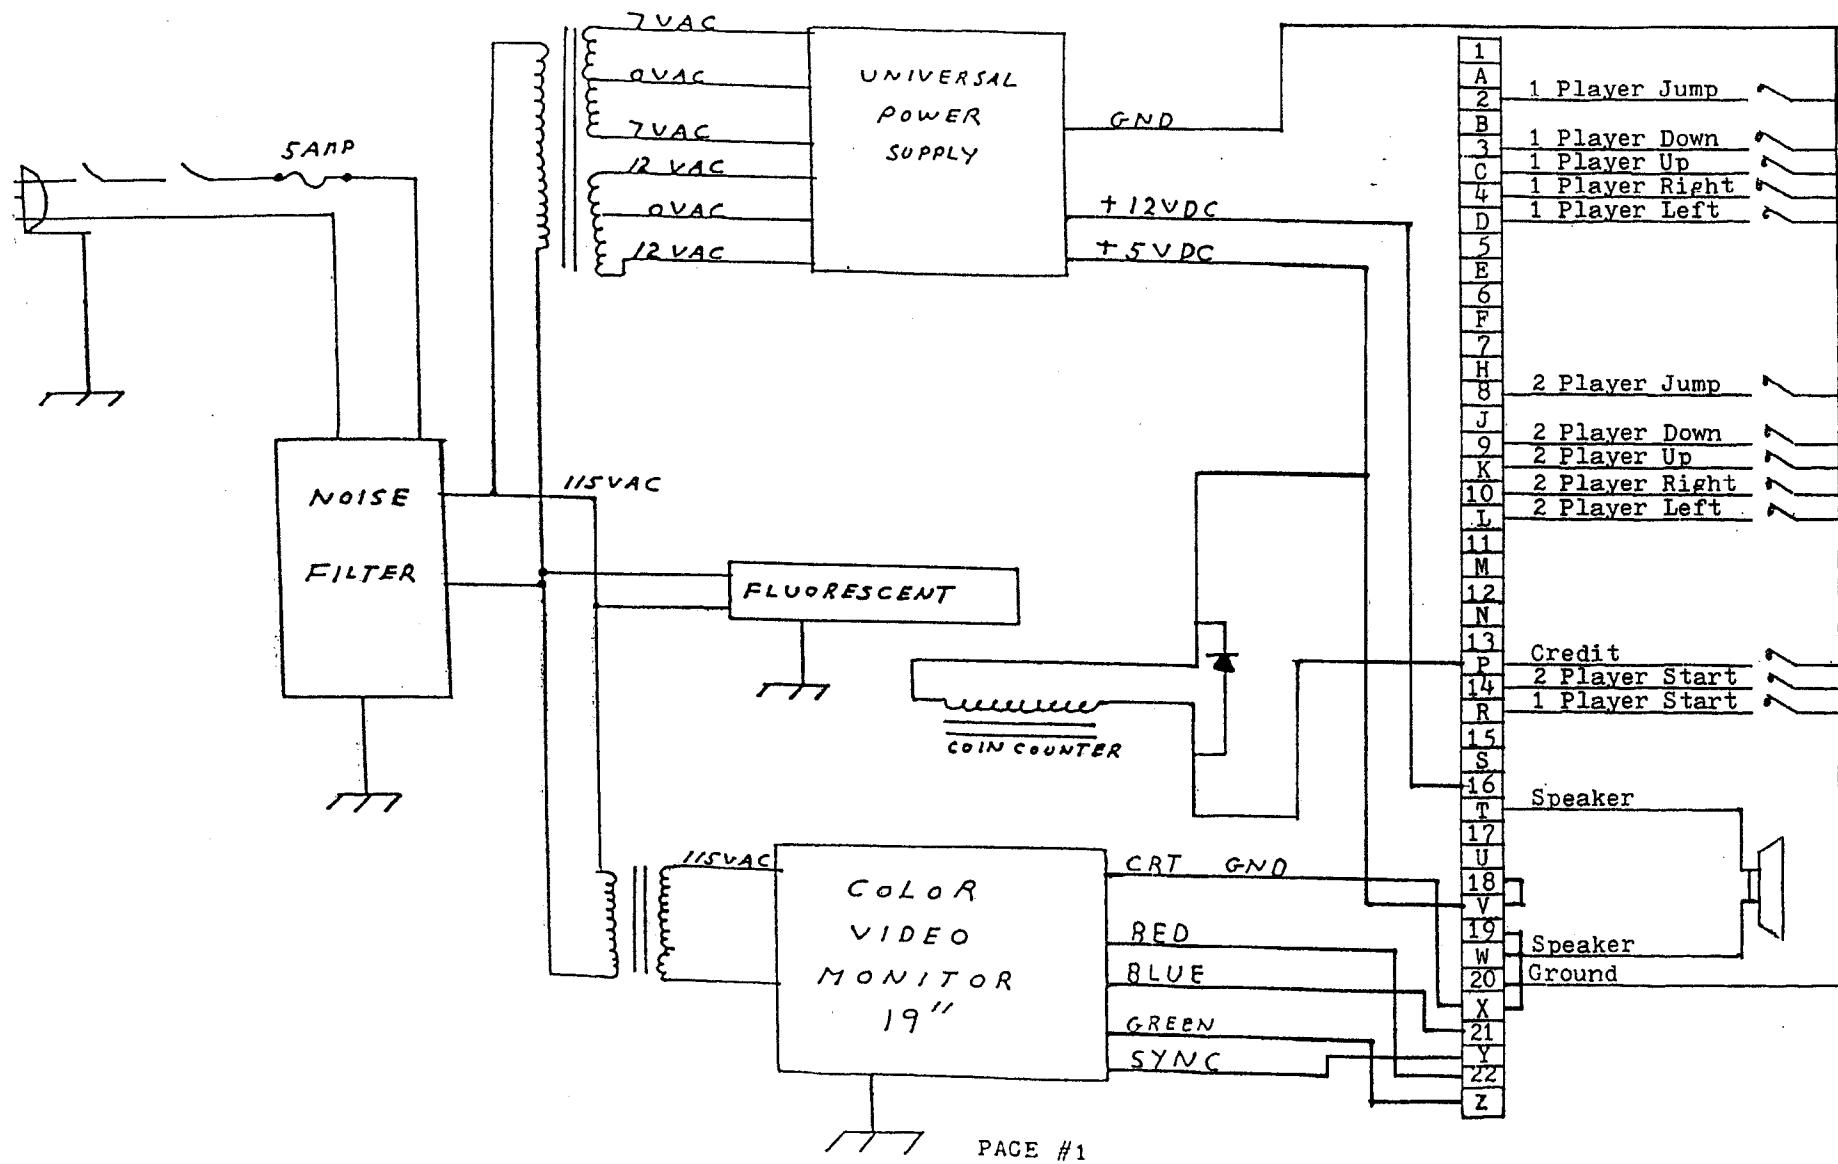

" C O N G O R I L L A "

Power Supply Connections

Socket P-1

1 12 VAC  
2  
3 12 VAC  
4 12 VCT  
5  
6 7 VAC  
7 7 VAC  
8  
9 7 VCT

Socket P-2

1 Gnd  
2  
3 Gnd  
4 -12 VDC  
5  
6 -20 VDC un reg  
7 -5 VDC  
8  
9 +20 VDC un reg  
10 +5 VDC  
11  
12 -10 VDC un reg  
13 +12 VDC  
14  
15 +9 VDC un reg

BIT SWITCH OPTIONS

Sw / Function	1	2	3	4	5	6	7	8
3 Gorillas	OFF	OFF						
4 Gorillas	ON	OFF						
5 Gorillas	OFF	ON						
6 Gorillas	ON	ON						

Bonus Gorilla @

7000 Points	OFF	OFF					
10000 Points	ON	OFF					
15000 Points	OFF	ON					
20000 Points	ON	ON					

1 Coin 1 Play		OFF	OFF	OFF			
1 Coin 2 Play		OFF	ON	OFF			
1 Coin 3 Play		OFF	OFF	ON			
1 Coin 4 Play		OFF	ON	ON			
2 Coin 1 Play		ON	OFF	OFF			
3 Coin 1 Play		ON	ON	OFF			
4 Coin 1 Play		ON	OFF	ON			
5 Coin 1 Play		ON	ON	ON			

Up Right Table ON  
Table OFF

" C O N G O R I L L A "  
Edge Connector Harness

1		A
2	1 Player Jump	B
3	1 Player Down	C 1 Player Up
4	1 Player Right	D 1 Player Left
5		E
6		F
7		H
8	* 2 Player Jump	J
9	* 2 Player Down	K * 2 Player Up
10	* 2 Player Right	L * 2 Player Left
11		M
12		N
13		P Credit
14	2 Player Start	R 1 Player Start
15		S
16	+12 VDC	T Speaker
17		U Coin Counter
18	+5 VDC	V +5 VDC
19	Pwr Gnd	W Speaker
20	Gnd	X Video Gnd
21	Video Blue	Y Sync
22	Video Red	Z Video Green

\* For cocktail table only, make following wire modifications.


9 2 Player Up  
10 2 Player Left  
K 2 Player Down  
L 2 Player Right

Number side is component side.




Letter side is solder side.

UNIVERSAL POWER SUPPLY  
Outline Drawing

Page #4

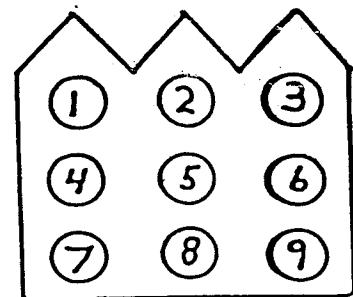


+12V Adjust

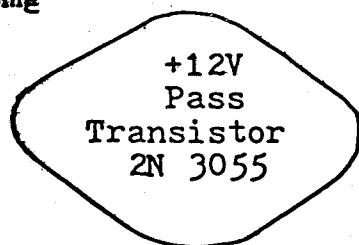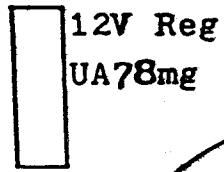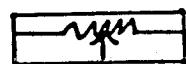

7912 -12V Reg.

7905 -5V Reg.

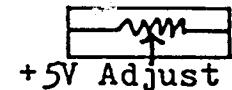

-12V Reg.

-5V Reg.

$\frac{1}{2}$  Amp Fuse

5 Amp Fuse

1 Amp Fuse

